



# VLF/AC Withstand Testing at NEETRAC

Jorge Altamirano, Tim Andrews, Nigel Hampton

## **Test Objective**

- To understand the appropriate withstand voltages and durations.
  - Existing standards unclear (IEEE 400 / 400.2)
  - Current practices vary greatly between utilities.


 To investigate the possibility that VLF voltages could deteriorate otherwise healthy cable (hypothesized from effect of DC voltage on XLPE insulation and anecdotal reports)

## **Voltage Withstand Test Program**

Utilized 12 lengths of 1973 vintage, 15 kV, XLPE cables from Exelon

| Sample<br>Set | Length<br>[ft] | Samples<br>Tested                           | Withstand Test Condition |                            |                      |        |
|---------------|----------------|---|--------------------------|----------------------------|----------------------|--------|
|               |                |   | Test Voltage<br>[U₀]     | Sinusoidal<br>Freq<br>(Hz) | Application Duration |        |
|               |                |   |                          |                            | Time<br>[mins]       | Cycles |
| А             | 280            | Field<br>Aged<br>XLPE<br>Insulated<br>Cable | Control – aging only     |                            |                      |        |
| В             | 280            |   | 2.2                      | 0.1                        | 15                   | 90     |
| С             | 280            |   | 2.2                      | 0.1                        | 120                  | 720    |
| D             | 280            |   | 2.5                      | 0.1                        | 60                   | 360    |
| Е             | 280            |   | 3.6                      | 0.1                        | 120                  | 720    |
| F             | 280            |   | 3.6                      | 60                         | 0.25                 | 900    |

# **Test Sequence**

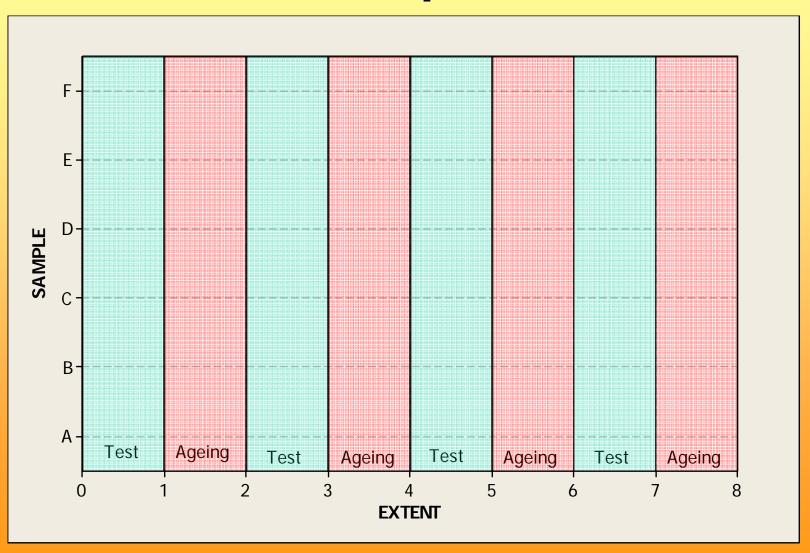

# **Elevated Voltage Test Equipment**



Voltage up to to 26 kV

Voltage up to 40kV




# **Test Underway**

Samples




#### **Failure Data**

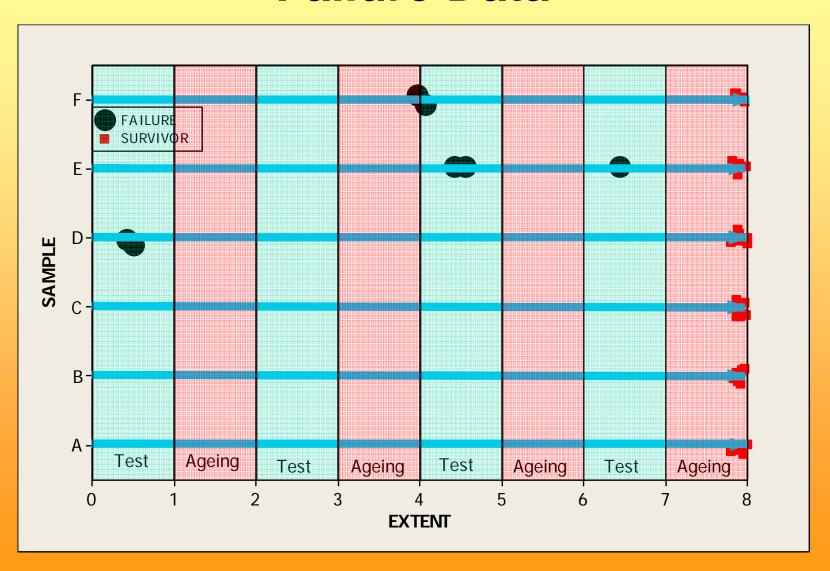


#### **Failure Time Data**




#### **NEETRAC VLF Failure Data**

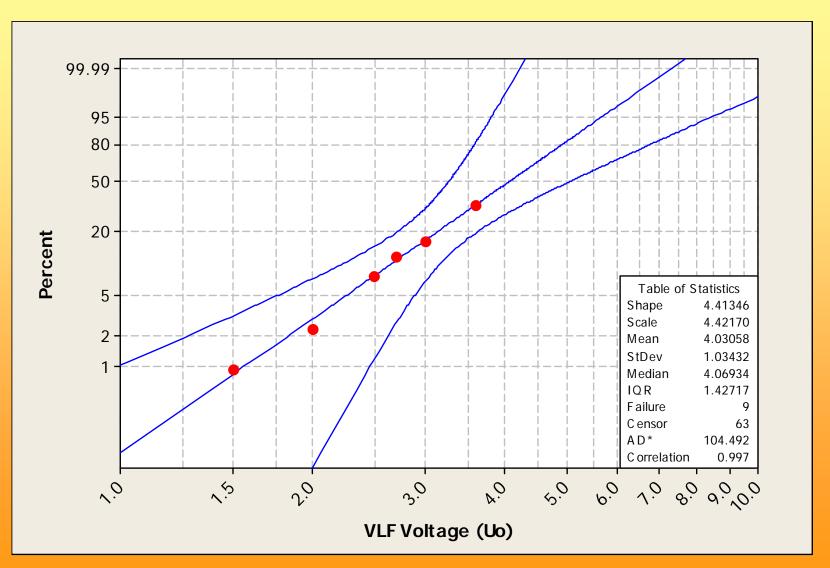

# **Survival Curve**

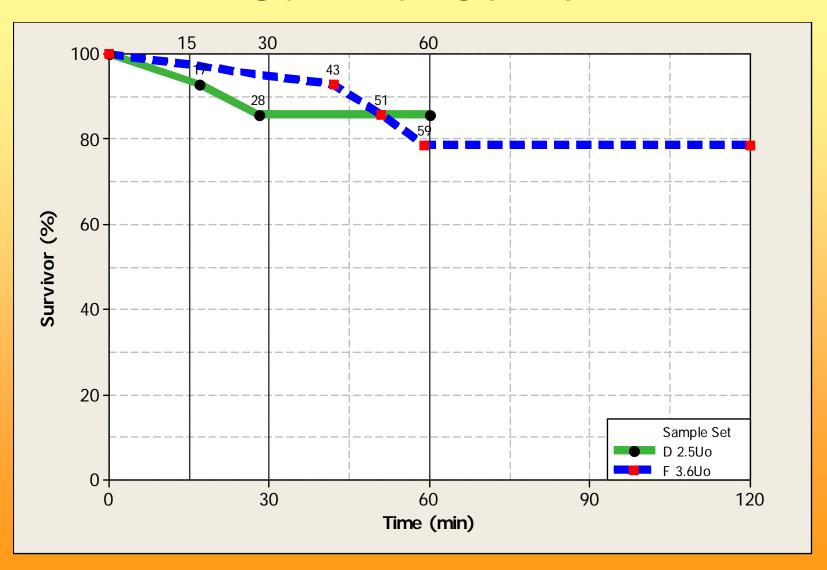

# Failure data in utility context

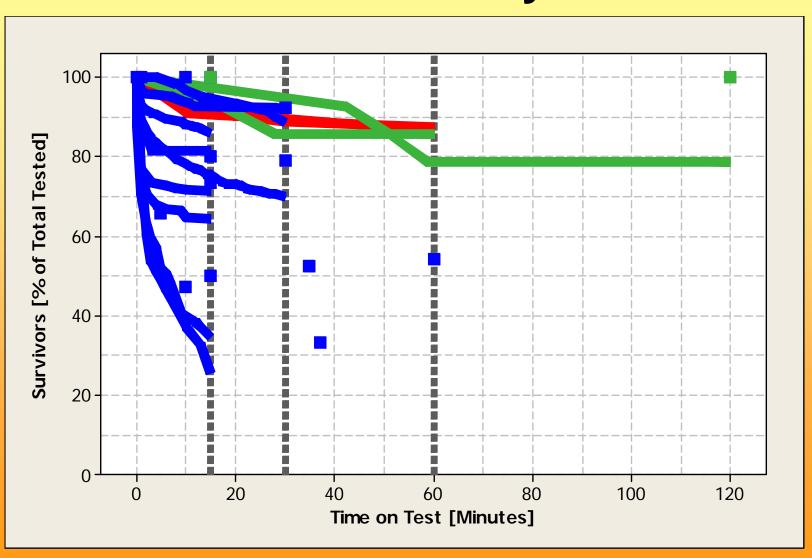

#### **60 Hz Failures**

- These are useful in understanding the condition of the cable samples
- Unintended failures occurred at 28 kV and 32 kV.
- For 15 kV cables, this suggests breakdown strengths of approximately 160 to 180 V/mil.
- These values would be considered characteristic of wellaged cable.

## **Summary**

- 5 failures on test.
  - All failures occurred between 15 and 60 minutes.
  - Withstand tests were conducted out to 120 minutes
- No samples failed during the aging periods.
- Time of failure data has been germane.
  - Ageing mechanism is responsible for failures on test.
  - Lab data may fit well with field data.
- Cable samples contain trees and have low strengths.

# Acknowledgements

- Exelon supply of cable samples
- HV Inc (Mike Peschel) loan of VLF test equipment
- Martin Baur, Craig Goodwin, Ben Lanz, Frank
   Petzold, Henning Oetgen valuable discussions
- This material is based upon work supported by the Department of Energy under Award No DE-FC02-04CH1237